


PERFORMANCE EXHAUST SYSTEM

YEAR	MODEL	
2011-2013 Suzuki GSX-R600 / 750		
PRODUCT		
1160000221	R77 Stainless Steel Full System Exhaust System with Carbon Fiber Sleeve; Carbon Fiber Endcap	
1160000521	R77 Stainless Steel Full System Exhaust System with Stainless Steel Sleeve; Carbon Fiber Endcap	
1160000551	R77 Stainless Steel Full System Exhaust System with Stainless Steel Sleeve; Stainless Steel Endcap	

	····· /·······························
$\mathbf{\overline{.}}$	In the state of California, it is illegal to modify the emission control system, which includes the fuel injection of any vehicle.
	You must know how to remove and replace your stock exhaust in order to install this product otherwise have it installed by a professional
	mechanic. Keep all stock parts from your existing system as some components may be necessary to install your new Yoshimura exhaust
-	depending on the application.
	Read through all instructions before beginning installation. Exhaust system can be extremely hot. Let motorcycle cool down before beginning
$ \cdot $	installation. Always wear hand and eye protection and take precautionary measures to avoid injury.

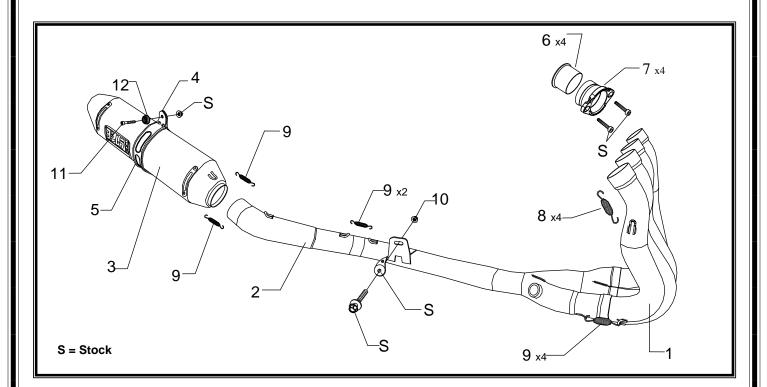

No.	Part #	Description	Qty
1	11600-404	Yoshimura Header	1
2	11600-419	Yoshimura Tailpipe	1
3	CRR77F126W SRR77F126W SRR77126W-SS	Yoshimura Muffler CF Sleeve; CF Endcap SS Sleeve; CF Endcap SS Sleeve; SS Endcap	1
4	1121-MPCA 1121-MPCAX	Muffler Clamp CF Sleeve SS Sleeve	1
5	HT SHLDR77	Muffler Clamp Heatshield	1
6	1228SMT	Yoshimura Manifold	4
7	1170SDY	Yoshimura Flange	4

8	RACE-SPX-1	Short Spring	4
9	RACE-SPS-1	Medium Spring	8
10	8MMNUT	8mm Flange Nut	1
11	M8X45	8mm x 45mm	1
		Soc Head Cap Screw	
12	M8ALCSW-00	M8 Counter Sink Washer	1
**	11600-RAD-BRKT	Radiator Bracket	1
**	11600-CKRPLT	EXCVA Stopper Plate	1
**	INS-03-K	SS Endcap	1
	INS-04-K	CF Endcap	
**	ST-200	Spring Puller Tool	1
**	OXYBA12X125SS	O2 Bung Adapter	1
**	17029	Yoshimura Sticker Sheet	1

5420 Daniels Street Chino, CA 91710 Tel (800) 634-9166 Fax (909) 591-2198 www.yoshimura-rd.com 1160000(221,521,551)_1

-TOOLS REQUIRED-

Metric Socket Set Combination Wrench Set Torque Wrench Metric Allen Wrench Set Screwdriver

-REMOVAL-

- 1. Remove left and right side fairing as per Factory Service Manual.
- 2. Remove stock muffler by loosening exhaust clamp and while securely supporting the muffler, remove muffler mount bolt.
- 3. Remove lower radiator support bracket and swing radiator forward to ease removal of stock header.
- 4. Remove O2 sensor from stock header.
- 5. Remove exhaust valve cables. NOTE: Stock exhaust valve cables will not be used with Yoshimura Full System Exhaust. For 2011 model, see wiring change. For 2012-2013 model, see EXCVA stopper installation.
- 6. Carefully remove stock header and exhaust port gaskets. (Note: Yoshimura Full System is designed to be installed without exhaust port gaskets.) NOTE: DO NOT remove upper bolt on stock chassis mount bracket. Remove lower bolt that secures the belly muffler onto the chassis.

-INSTALLATION-

1. Install Yoshimura manifolds and flanges into exhaust ports using stock header bolts. Torque to 7.3 *ft-lb.* (10 Nm, 1.0 kgf-m) See flange orientation below.




- 2. Install Yoshimura header from one end of the engine to the other by slipping one header leg at a time onto manifolds. (Note: Lightly tap header legs with a plastic mallet to ensure a tight fit.)
- 3. Connect header to flanges using the supplied springs.
- 4. Install chassis mount bolt to secure header. Torque to 16.5 ft-lb. (23 Nm, 2.3 kgf-m)
- 5. Slide Yoshimura muffler and tailpipe assembly onto header.
- 6. Install rubber heat insulator onto Yoshimura muffler clamp. Slide muffler clamp over muffler and install muffler clamp to the inside of the stock muffler mount bracket using supplied hardware. See diagram for orientation. (Note: Twisting of tailpipe may be necessary for proper alignment. If needed, remove muffler springs to twist tailpipe for proper alignment.)
- 7. Install springs on tailpipe to header connection.
- 8. Re-install stock O2 sensor onto Yoshimura header.
- 9. Re-install radiator bracket. (Note: For GSX-R750, use provided Yoshimura radiator bracket.)


-FITMENT CHECK & NOTES-

- 1. Before starting motorcycle, check for proper clearance between new exhaust system and rear suspension (i.e. tire, swing-arm, brake, rear shock, engine, and etc.) If any problem is found, please carefully follow through the installation steps again. If problem still persists, please call Yoshimura Tech Department at (800) 634-9166 / in CA (909) 628-4722.
- 2. It is recommended that the muffler and tailpipe be wiped down with rubbing alcohol to remove oil and fingerprints. This will help prevent tarnishing of the finish after the exhaust is heated up.
- 3. NOTE: After starting motorcycle, it is normal for new exhaust system and muffler to emit smoke until oil residue burns off.

-NECESSARY WIRING CHANGES- (For 2011 Model Only)

- 1. It is necessary to properly disable the Suzuki SET (Suzuki Exhaust Tuning) system by following the steps listed below. Without properly disabling the SET system, the engine will run in a power limited fail-safe mode.
- 2. Remove rider seat and lift fuel tank.
- 3. With ignition in the OFF position, disconnect the black wire harness plug from the ECU. See Fig. 2
- 4. Remove the orange cap by pressing the small orange tabs on the side apart and pulling the orange cap off. See Fig. 3
- 5. Remove #5 wire (Brown/Black Stripe) by inserting a very small flat head screwdriver into the pin hole and gently pry down to unlock the wire and pull the wire out from the rear of the plug. (Note: If you do not have a small flat head screwdriver, you can make one using a regular paper clip. See Fig. 4)
- 6. Completely seal off the disconnected wire using electrical tape and shrink tube to prevent possible electrical problems. Secure disconnected wire to harness using a zip tie.
- 7. Re-install orange cap onto black wiring harness plug and re-connect plug to ECU.
- 8. Lower fuel tank and re-install rider seat.
- 9. Completely remove the exhaust valve cables from the EXCVA servo. Refer to Factory Service Manual for removal instructions. (Note: Do not unplug EXCVA servo as it may cause the bike to run in fail-safe mode.

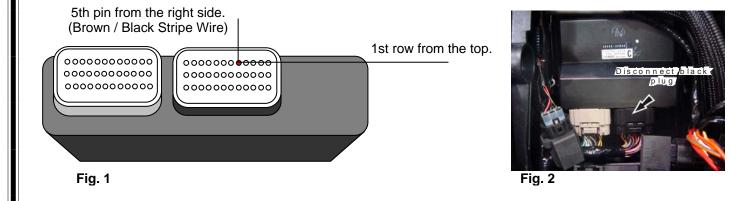

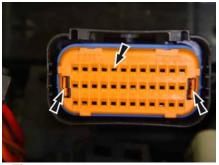







-EXCVA STOPPER BRACKET INSTALLATION- (For 2012-2013 Model Only)

- 1. Remove rider seat and lift fuel tank.
- 2. With the ignition in the OFF position, remove the (2) bolts securing servo motor to frame. See Fig. 5
- 3. Completely remove exhaust valve cables from the EXCVA servo. Refer to Factory Service Manual. Note: DO NOT turn on the ignition when cables and pulley is removed.
- 4. While securely holding the pulley, remove pulley mounting bolt. Note: Pulley must stay in original position when removing bolt to prevent damage to the internal gear of EXCVA.
- 5. Using the stopper bracket provided in the kit, install bracket to EXCVA using stock bolt. Torque bolt to 5Nm. (0.5kg-m,3.5lb-ft) See Fig. 7 Note: The stopper bracket tabs on the ends should be pointing up when properly installed. Improper installation may permanently damage servo motor.
- 6. Reinstall EXCVA onto frame using the opposite steps of removal.



Fig. 5



Fig. 6

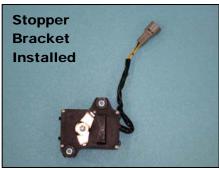


Fig. 7