

YOSHIMURA

RESEARCH&DEVELOPMENT OF AMERICA, INC.


5420 DANIELS STREET STE A, CHINO CA., 91786 · (800)634-9166 · (909)628-4722 · FACSIMILE (909)591-2198


www.yoshimura-rd.com

RS-3 OVAL PERFORMANCE EXHAUST SYSTEM

SUZUKI '99-06 GSX1300R

R14850C	ZYCLONE BOLT-ON SYSTEM		
R14950	RACE ONLY BOLT-ON SYSTEM		
R149502	RACE ONLY BOLT-ON SYSTEM		

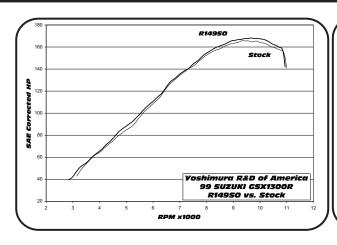

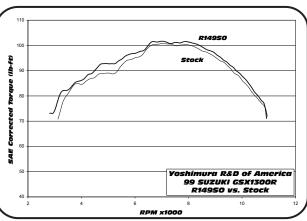

Note: Dyno graphs are for comparison use only. Actual results may vary depending on operating and motorcycle condition.





Installation Procedures:

Page 2

Caution: Exhaust system can be extremely hot. Let motorcycle cool

down before beginning installation.

Note: Read through all instructions before beginning installation.


Tools Needed:

12mm socket 3/8" ratchet 12mm and 14mm wrenches Torque wrench

Installation Steps:


- 1 Remove stock mufflers and muffler gaskets.
- 2 Install new muffler gaskets. (Not supplied - Suzuki part no. 14181-33E00)
- 3 Install Yoshimura mufflers using supplied bolts. Torque bolts to 2.3 kg-m (16.5 lb-ft).
- 4 Apply heat insulator to inside of muffler clamps and slide clamps onto mufflers.
 (note direction of clamp in Fig. 1&2)
- 5 Mount clamps to stock muffler brackets using supplied bolts, washers, and nuts. (Fig. 1&2)
 Torque bolt to 2.5 kg-m (18 lb-ft).
- 6 Check for proper clearance between new muffler and motorcycle. (i.e. swing-arm, passenger foot-peg, rear wheel, etc.) If any problem is found, please carefully follow through the installation steps again. If a problem still persists, please call Yoshimura technical department. at (800)634-9166 / in California (909)628-4722

Note: After starting motorcycle, it is normal for new exhaust system and muffler to emit smoke until oil residue burns off.

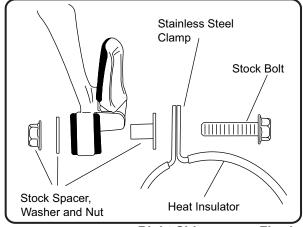

Right Side

Fig. 1

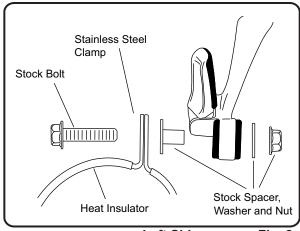


Left Side

Fig. 2


Part List: Page 3

#R14850C, #R14950, #R149502

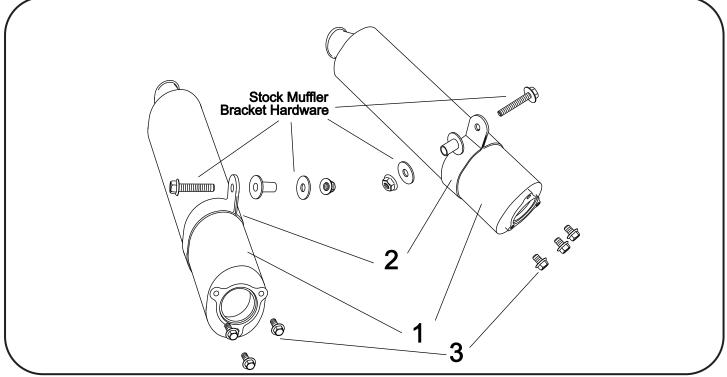

Parts Diagram

NO.	DESCRIPTION	QTY	PART #
1	RS-1/RS-3 Oval Muffler Assembly	2	**
2	Stainless Steel Muffler Clamp		
	Stainless Steel or Titanium Sleeve uses	2	COS450S8ASX
	Carbon Fiber Sleeve uses	2	COS450S8AS
3	8mm x 20mm Flange Hex Bolt	6	M8X20H
**	Muffler Clamp Heat Insulator	2	HT SHLD TRS
**	Yoshimura Vinyl Sticker	2	17100

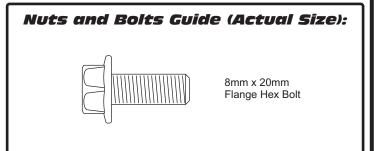



Dear Yoshimura Customer.

Congratulations and thank you for purchasing a Yoshimura Exhaust System. Over six decades of experience in research and development, state of the art machinery, materials and craftsmanship of the highest quality all come together in a product of exceptional quality and performance—in other words, this is the best thing you can put on your bike.

We strive to provide you with a product perfect in fit and finish. However, if you have any problems, please give us a call. We have found that most fitment issues can be easily resolved by a conversation with one of our knowledgeable and friendly staff. If the issue cannot be resolved this way, our warranty evaluation program may be the answer. Please take a moment to review our recommendations for the care of your exhaust and our warranty information.

PLEASE NOTE: If you have any doubts about your exhaust: DO NOT START THE MOTORCYCLE! ONCE AN EXHAUST HAS BEEN USED OR MODIFIED, IT CANNOT BE RETURNED FOR CREDIT OR EXCHANGE.

EXHAUST SYSTEM MAINTENANCE

Yoshimura Exhaust Systems require very little care and maintenance; here are a few tips:

- 1. Use mild car/motorcycle soap to clean the exhaust system—do not use any abrasives or degreasers.
- 2. Clean your exhaust with metal/stainless polish every 1-2 months to retain the luster and remove dirt and grime. (DO NOT USE POLISH ON "WORKS FINISH" SYSTEMS)
- 3. Avoid contaminating exhaust surfaces when hot.
- 4. Your exhaust system will change color (blue, magenta, purple, and/or gold) due to heat; this is normal.
- 5. Keep all clamps, bolts and other fasteners tight as exhaust systems are susceptible to vibration damage.
- 6. If you ride in coastal regions or areas that use salt to control ice and snow, wipe the exhaust down after it cools to remove any possible salt residue, which can result in rusting.
- 7. If you are storing your motorcycle for the season, wipe the exhaust system down with rubbing alcohol before storage.
- 8. Head pipes glowing (visible in normal light) may indicate an excessively lean condition that must be corrected.

CARBON FIBER:

Carbon fiber equipped exhaust components require special attention.

The following addresses wear issues directly related to carbon fiber:

- 1. Keep all clamps, bolts and other fasteners tight. Carbon Fiber is very susceptible to vibration damage.
- 2. Keep all chemicals and solvents away from the carbon fiber, as they will damage the finish.
- 3. High temperatures will cause the resin in the carbon fiber to break down. Visual signs such as an amber hue in the resin may be early signs of heat damage to carbon fiber.
- 4. Upon seeing amber colored resin, discontinue use. The exhaust system needs to be inspected by a representative from Yoshimura, for repack, and/or repair. Continued use will cause component failure.

STAINLESS STEEL:

Stainless Steel is not rust proof but is less prone to rusting, staining and pitting; but it is prone to oxidation like all metals.

WORKS FINISH:

- 1. Works Finish exhaust systems should never be cleaned with abrasives or polishes.
- 2. Yoshimura recommends using "Bar Keepers Friend" cleaner to remove minor stains.
- 3. Surface reconditioning services are available to remove scratches and undesirable discoloration due to extreme heat. Contact Yoshimura Tech Department at (800) 634-9166 / in CA (909) 628-4722 for more information.

RE-PACKING TIPS

To maintain maximum sound and engine performance the muffler packing will need to be replaced at some time during the muffler's life. Yoshimura recommends repacking your muffler at least once a year.

Failure to maintain the muffler packing may cause damage to the muffler and/or void the warranty. Regularly inspect the muffler body for discoloration, cracks, rattling, or other signs of wear caused by depleted muffler packing. If muffler packing is determined to be depleted or worn, a Yoshimura muffler re-pack kit is highly recommended to restore the muffler to optimum maximum performance.

Yoshimura offers a 3-5 day turn around (plus transit time) to inspect and refurbish used and damaged mufflers.

For more information on muffler repacking please visit our website at:

http://www.yoshimura-rd.com/muffler-repacking

IMPORTANT TECHNICAL NOTE

Yoshimura recommends on all race exhaust systems, that all spring joints be safety wired. Recommended wire type 304/316 stainless steel with a .032" diameter should be used.

YOSHIMURA EXHAUST LIMITED WARRANTY

All Yoshimura R&D of America, Inc., exhaust systems carry a one-year limited warranty against defects in workmanship and/or materials.

WHO IS COVERED?

This warranty is provided to the original purchaser of the exhaust system.

WHAT VOIDS THE WARRANTY?

- 1. Abuse, misuse, improper installation and/or modifications
- 2. Custom applications
- 3. No proof of purchase at the time of warranty. Claimant must provide proof of purchase (original receipt or invoice) and a warranty authorization number (RMA) obtained from Yoshimura.
- 4. Finishes such as plating or painted surfaces with discoloration or rust due to inclement weather conditions, exposure to salt, exposure to chemicals, or lack of maintenance by the customer are not covered.
- 5. International grey-market product purchased through a dealer/distributor not authorized for your country will not be supported by this warranty.

EXTENT OF WARRANTY:

Any defective exhaust system properly returned to Yoshimura will be repaired or replaced by Yoshimura. Yoshimura is not responsible for any other expense incurred by the customer under the terms of this limited warranty, nor is Yoshimura responsible for any damages either consequential, incidental, special, contingent or otherwise; or expenses or injury arising directly or indirectly from the use of the exhaust system. Any exhaust system returned to Yoshimura must be sent at the customers expense along with the proof of purchase and warranty authorization (RMA). Yoshimura reserves the right to determine whether the terms of the warranty, set out above, have been properly followed. In the event that the terms are not followed this warranty is void. Yoshimura is the sole determiner of abuse, misuse, installation errors and modifications—should any of these be found, this warranty is void. The duration of any and all implied warranties are limited to the duration of the express warranty. All incidental or consequential damages are herby excluded. The warranty gives you specific legal rights and you may have other rights, which vary from state to state. Some states do not allow the exclusion or limitation of incidental or consequential damages or limitations on how long an implied warranty lasts, so the above limitations and exclusions may not apply to you.

If you have a fitment or other problem, or are missing a part, please double-check this trouble shooting guide first:

- 1. Reference your instruction sheet and double-check all drawings and instructions
- 2. Make sure muffler clamps are installed correctly (refer to instructions diagram). On many models, there is a right and wrong way to install. Also verify part numbers on headers and tail pipe.
- 3. Always make sure to install spring-mounted manifolds and flanges on cylinder head prior to installing headers.
- 4. Always take time to examine problems in detail.
- 5. When all else fails, call our technical support line at (909) 628-4722. The technical line is open 9:00am 4:30pm Monday through Friday, Pacific Time. Please have the following information handy: Year/Make/Model of motorcycle, date of purchase, place of purchase, batch dates and part numbers (found on header and tail-pipe components).
- 6. Also, feel free to ask through online e-mail at sales@yoshimura-rd.com, or fax your question/problems to (909) 591-2198.